


# COOLVIEW™ THERMOMETER

## Packing List

- 1 Coolview Thermometer
- 1 Grooved Backnut
- 1 J96 Silicone O ring

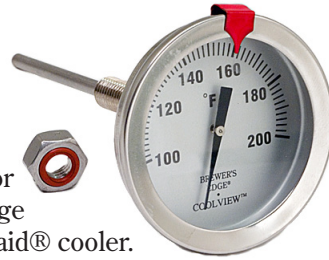

The Coolview makes it easy to monitor the temperature of your mash or sparge in a 5 or 10 gallon Igloo® or Rubbermaid® cooler. Although factory calibrated, it features a calibration backnut so you can fine tune the adjustment if desired by using an 11mm wrench and moving the pointer while using a calibration thermometer (we suggest you use any alcohol in glass type to calibrate if desired). You will need a 5/16" drill bit (other drill bit sizes will cause leaks) and drill to install in a 5 or 10 gallon cooler.

## Installation

In your 5 or 10 gallon cooler, first determine a mounting spot. A good spot is 7" up from the outer bottom of the cooler on a 5 gallon cooler, and 8" up from the outer bottom on a 10 gallon cooler. Now put on safety glasses and drill a 5/16" hole (you must use a 5/16" drill bit) at your desired mounting spot. Clean any chaff from the hole and thread in the thermometer. Once in, stretch the orange O ring to fit around the barrel and press it tight against the inside of the cooler. Now thread on the backnut with the **O ring groove facing the O ring**.



Tighten firmly by hand, and then use a 13mm or small crescent wrench to tighten another turn and a half (do not overtighten). It is normal when properly tightened to be able to rotate the outside dial with your hand.

## To Use

Set the sliding red pointer to your target mash temperature, or if using your cooler as a sparge water tank, at sparge water temperature.

**Brewer's Edge® San Leandro CA**

Final Inspection by #5